
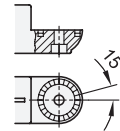



Type OZ

Type AV

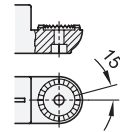

Type MZ

Type IV




2 Type

- OZ** Without centering step (smooth)
- MZ** With centering step
- AV** With male serration
- IV** With internal serration

3 Identification no.

- 2** With stainless steel socket cap screw DIN 912

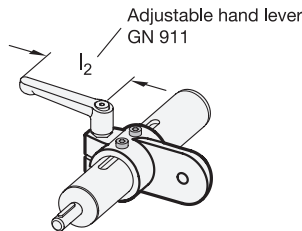

1

d ₁ Bore	Bore		b Swivel width	d ₂	d ₃ Mounting screws on the drive key	k Clamping length	l ₁	m	s	t	z Screw location	Accessory	
	without sleeve bearing	with sleeve bearing										Recom. hand lever GN 911 for z	l ₂
B 30	G 30		40	8,5	M 4	40	95	43	13	20	M8-25	63	78
B 40	G 40		65	10,5	M 5	65	148	70	17	32,5	M10-50	-	-
B 50	G 50		65	10,5	M 6	65	148	70	17	32,5	M10-50	78	92

Specification

- Aluminum
Powder coated
Black, RAL 9005, textured finish **● SW**
- Sleeve bearing
Plastic (PTFE)
- Socket cap screws DIN 912
Stainless steel AISI 304
- Hex nuts DIN 985
Stainless steel AISI 304
Self-locking via polyamide ring
- *Plastic Characteristics* → Page 2158
- *Stainless Steel Characteristics* → Page 2166
- **RoHS**

Accessory

- Adjustable Hand Levers GN 911 → Page 1784

Information

Swivel clamp linear actuator connectors GN 274.1 are based on swivel clamp connectors. The additionally provided mounting holes are used to connect to the drive key of a linear actuator. Bores with the designation „G“ are equipped with sleeve bearings.

With the screw location **z**, the play of the guide bore d₁ can be adjusted or the linear actuator connectors can be clamped after adjustment.

For quick clamping without tools, the socket cap screw can be replaced by an adjustable hand lever GN 911 listed in the table as accessory.

see also...

- *Linear Actuators GN 291* → Page 1950
- *Linear Actuators GN 292* → Page 1952
- *Linear Actuators GN 293* → Page 1953

How to order

1	d ₁
2	Type
3	Identification no.
4	Finish

GN 274.1-G50-OZ-2-SW