
Base Plate Linear Actuator Connectors

Stainless Steel



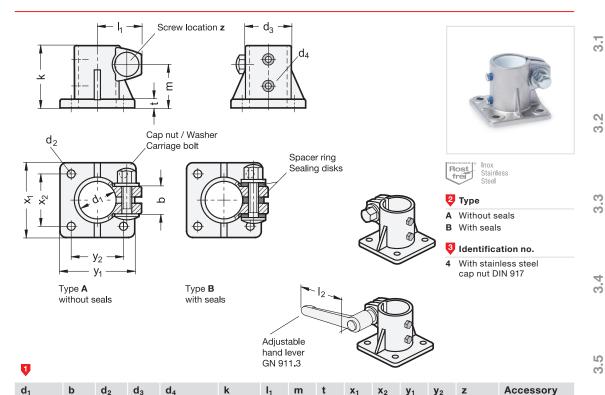

Specific	cation

Bore

bearing

G 30

G 50

with sleeve

 Stainless steel AISI CF-8 Matte shot-blasted

22

30

- Sleeve bearing Plastic (PTFE)
- · Carriage bolt DIN 603 Stainless steel
- · Cap nuts DIN 917 / Washers Stainless steel
- Seals
 - Sealing disks Plastic (Polyacetal POM)
 - Spacer ring Silicon, 40 ... 60 Shore A
- Plastic Characteristics → Page 2158
- · Stainless Steel Characteristics → Page 2166
- RoHS

Accessory

· Adjustable Hand Levers GN 911.3

→ Page 1785

Mounting

screws on

M 4

M 6

37

60

6,5

10.7

the drive key

Information

36

35

48.5 60

6,5

9

60 42

105 74

Clamping

length

50

85

Flanged linear actuator connectors GN 163.15 are based on flanged connector clamps. The additionally provided mounting holes are used to connect to the drive key of a linear actuator. Bores with the designation "G" are equipped with sleeve bearings.

60

105

42

74

Screw

location

M 8

M 10

Recom. hand lever

78

92

ന

3

GN 911.3 for **Z**

l₂

63

78

With the screw location z, the play of the guide bores d1 can be adjusted or the linear actuator connectors can be clamped after adjustment. Type B is equipped with seals at the screw locations.

For quick clamping without tools, the cap nut can be replaced by the adjustable hand levers GN 911.3 listed in the table as accessories.

see also...

- Linear Actuators GN 291 → Page 1950
- Linear Actuators GN 292 → Page 1952
- Linear Actuators GN 293 → Page 1953

How to oder	1	d ₁
GN 163.15-G50-A-4	2	Туре
	3	Identification no.

0